

Front Seat Squeak Noise (Apply Lubricant)

TECHNICAL SERVICE BULLETIN

Reference Number(s): 06-08-50-007, Date of Issue: June 28, 2006

Affected Model(s): 2006 Chevrolet HHR

CONDITION

Some customers may comment that the front seat squeaks.

CORRECTION

1. Move the seat all the way forward and upward.

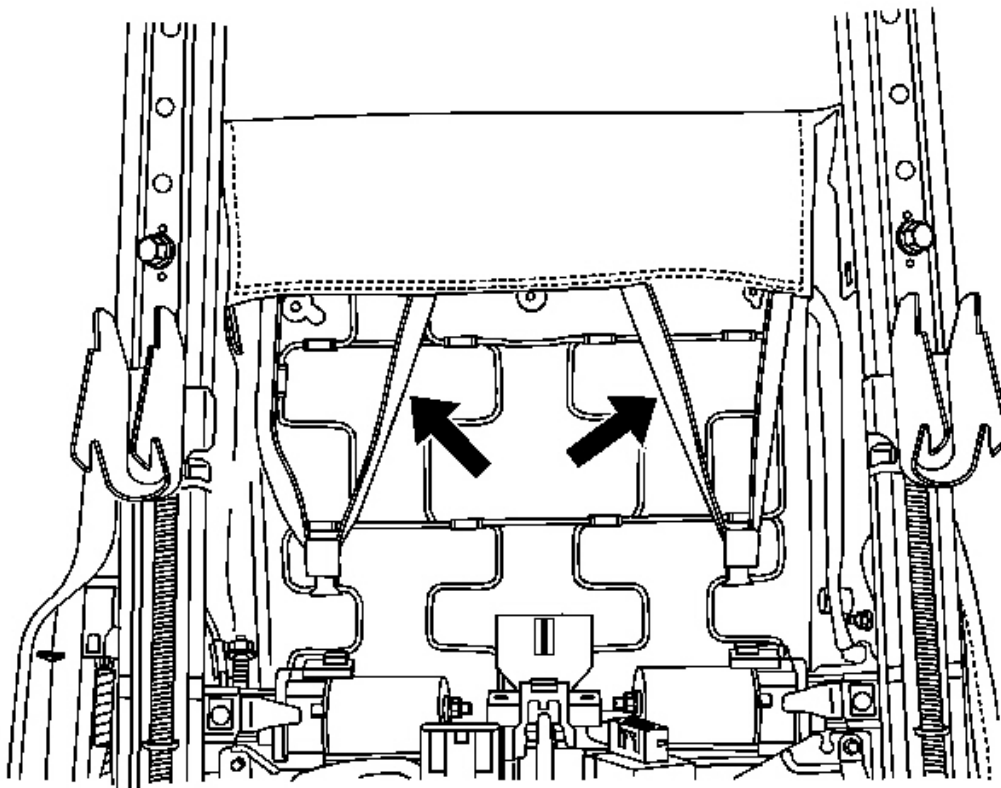


Fig. 1: Removing Elastic Straps
Courtesy of GENERAL MOTORS CORP.

2. Reach under the seat to remove the two elastic straps for the kick plate.

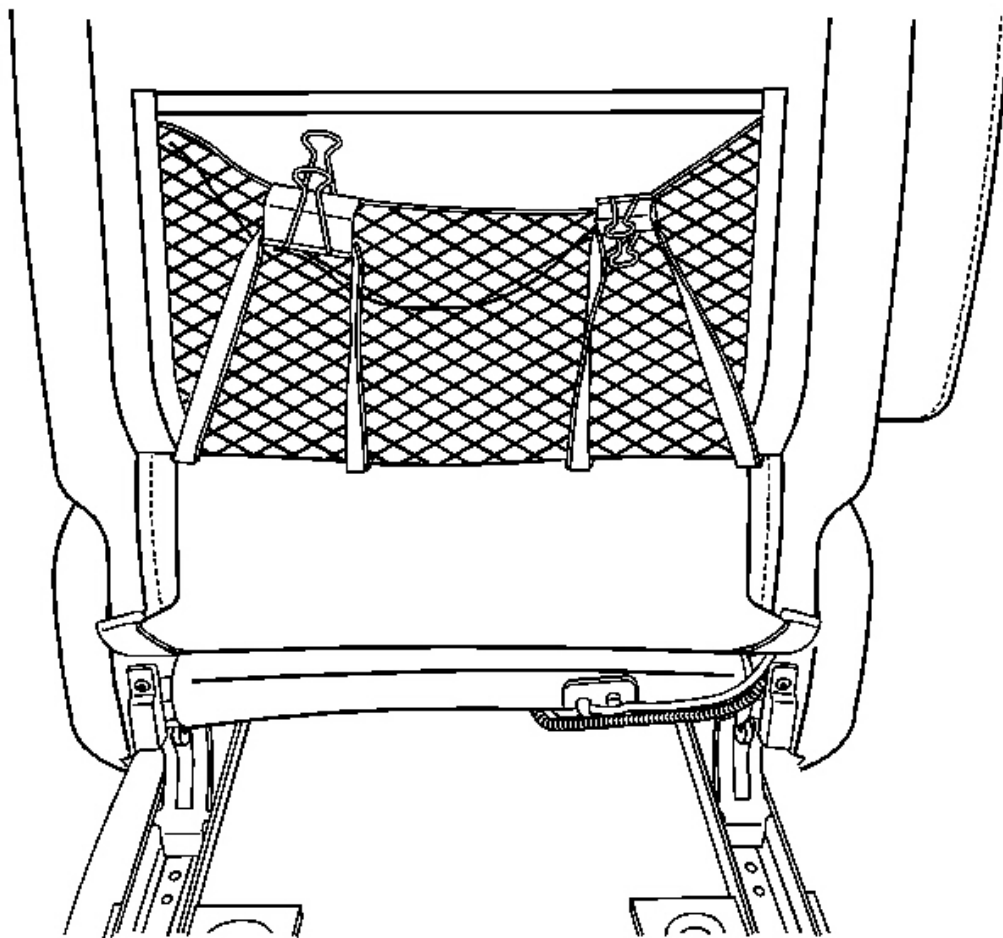


Fig. 2: Supporting Kick Plate
Courtesy of GENERAL MOTORS CORP.

3. Support the kick plate with two clips. Refer to the illustration above.
4. Remove the screw from the plastic trim on each side of the seat.
5. Pull the trim outward.
6. Protect the carpet from spraying the lubricant in the next step.

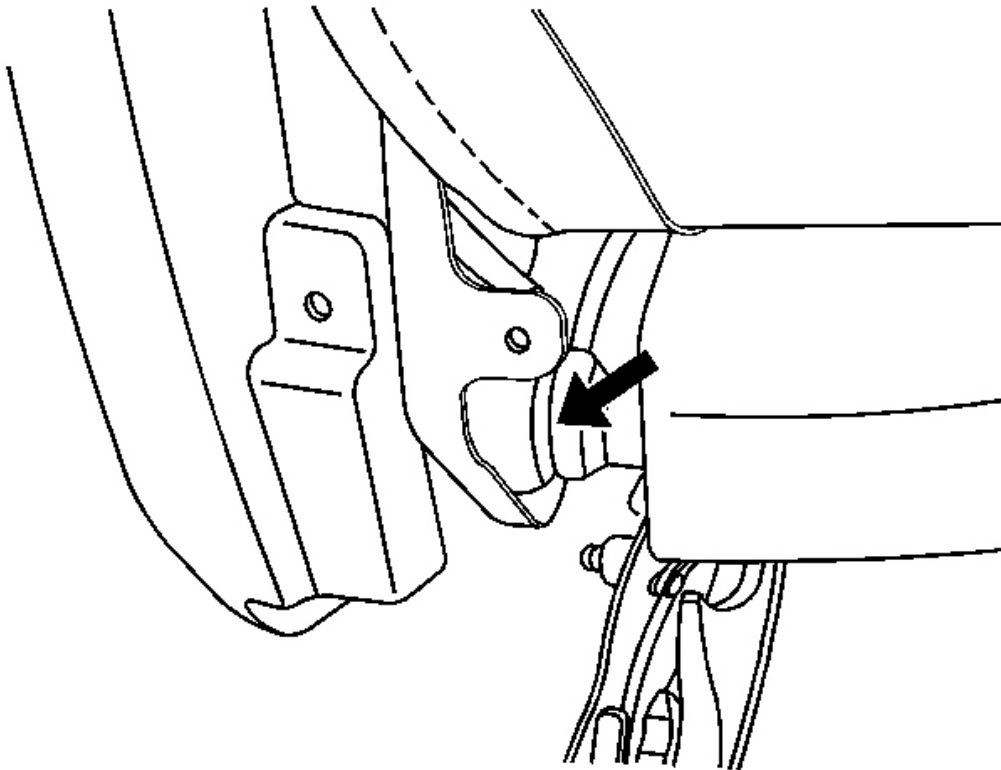


Fig. 3: Locating Lift Arm Pivot Point
 Courtesy of GENERAL MOTORS CORP.

7. Lubricate the lift arm pivot point. Refer to the illustration above.
8. Reinstall the plastic trim and the kick plate.

PARTS INFORMATION

Parts Information

Part Number	Description
89021668 (in Canada, 89021674) or 12346241 (in Canada, 10953474)	GM Lubriplate Lubricant or Super Lube(R)

WARRANTY INFORMATION

For vehicles repaired under warranty, use:

2006 Chevrolet HHR LT

Front Seat Squeak Noise (Apply Lubricant)

Warranty Information

Labor Operation	Description	Labor Time
C9764	Lubricate seat back pivot point	0.2 hr